


Push-Pull BNC

75Ω Cable Connector


Chuck type strain relief

Assembly Instructions

Select the proper connector part number in Neutrik's cable cross reference list!

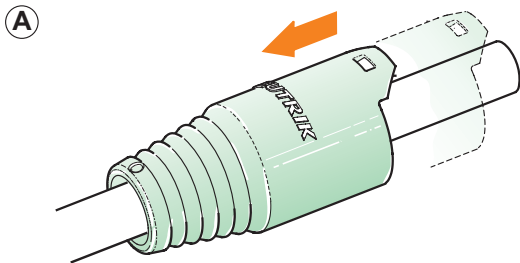


A Slide the boot onto the cable.

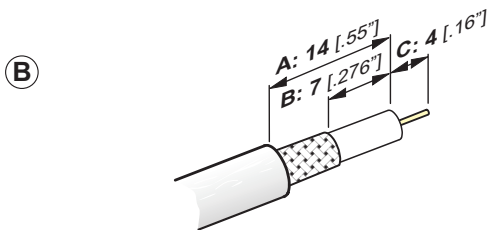


B Prepare cable as shown.

- Use an adjustable coaxial cable stripper is recommended.

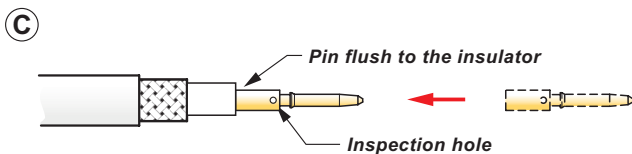

C Crimp the pin.

- position the pin on the center conductor
 - Crimp the pin with the tool
- (For best crimping-results it is recommended to use the original Neutrik crimp tool - HXBNC with the corresponding insert or hexcrimp acc. to IEC 803-W (SW 1.7) or squarecrimp acc. to IEC 803-2 (SW 1.6)
- Pin can also be soldered (Optional)!

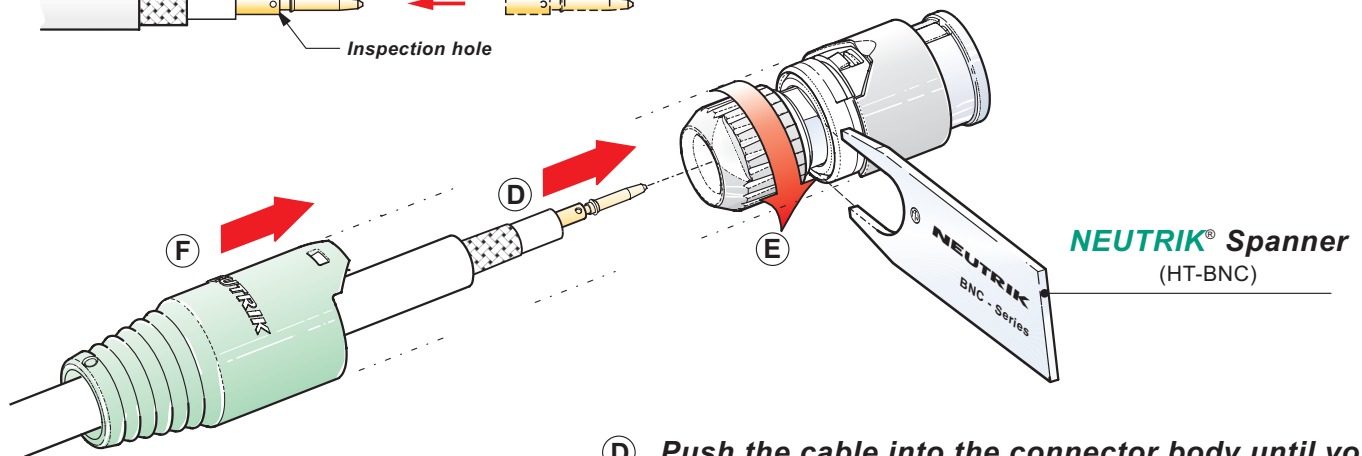


D Push the cable into the connector body until you hear a snap.

E Tighten the bushing.

- for stronger tightening use the Neutrik Spanner HT-BNC

F Snap the sleeve onto the connector body.

Assembled Connector

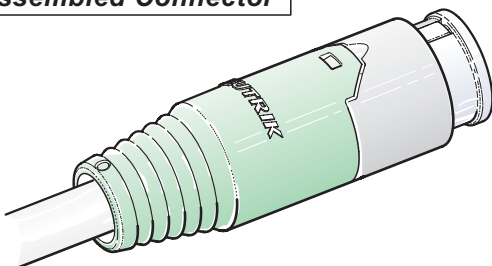

NEUTRIK AG
Liechtenstein
Tel.: +423/237 24 24
Fax: +423/232 53 93
www.neutrik.com

NEUTRIK Zürich AG
Switzerland
Tel.: +41 1/736 5010
Fax: +41 1/736 5011

NEUTRIK (UK) Ltd.
Great Britain
Tel.: +44 19 83/811 441
Fax: +44 19 83/811 439

NEUTRIK USA INC.
USA
Tel.: +1 732/901 9488
Fax: +1 732/901 9608

NEUTRIK Tokyo Ltd.
Japan
Tel.: +81 3/3663 4733
Fax: +81 3/3663 4796

NEUTRIK Vertriebs GmbH
Germany / Netherlands
Tel.: +49 8131/28 08-90
Fax: +49 8131/28 08-30

Draft No.: BDA 46 / 3102M0761
Update: 21.01.2002

Data subject to change without prior notice. ©2002 NEUTRIK®. ALL RIGHTS RESERVED.



NEUTRIK®
CONNECTING THE WORLD