


BNC


75Ω Cable Jack Tiny


Assembly Instructions

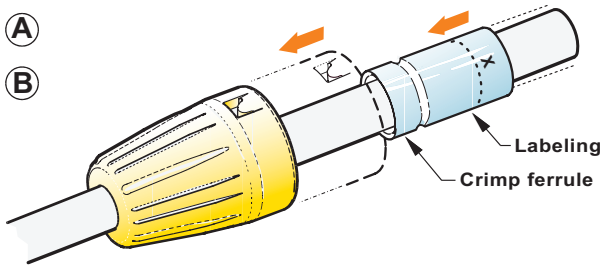


- (A) Slide the boot onto the cable
- (B) Slide the crimp ferrule onto the cable


- (C) Prepare cable as shown
 - Use an adjustable coaxial cable stripper

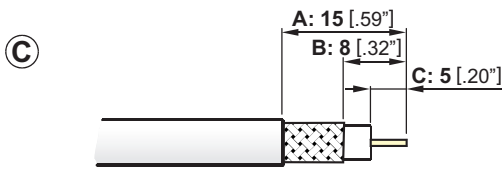



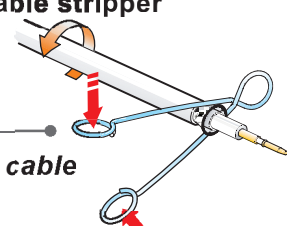
- (D) Spread the braided shield
(It's easily with the Neutrik "SHIELD-SPREADING-TOOL"!)
 

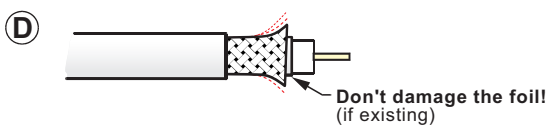

- (E) Slide the leading ferrule on the cable
- (F) Crimp the pin
 - position the pin on the center conductor
 - Crimp the pin with the tool
(For best crimping-results it is recommended to use the original Neutrik crimp tool
- HXBNC with the corresponding insert
or hexcrimp acc. to IEC 803-W (SW 1.7)
or squarecrimp acc. to IEC 803-2 (SW 1.6)
 - Pin can also be soldered (Optional)!

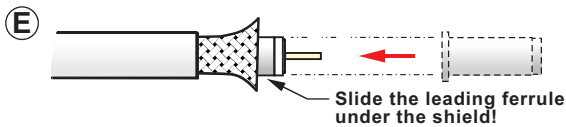

 - (G) Insert the cable into the connector body
- (H) Slide the crimp ferrule over the shield to the front and push the cable and leading ferrule to it's end position until you hear a snap noise.

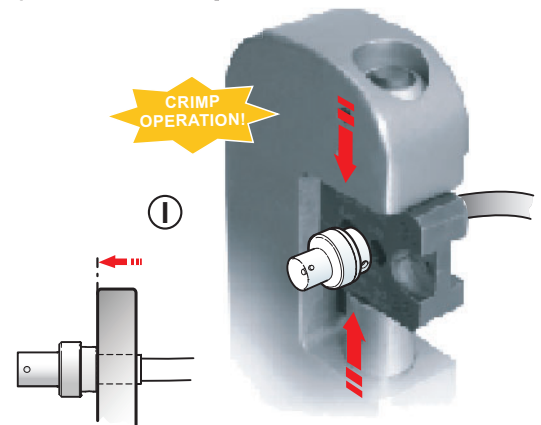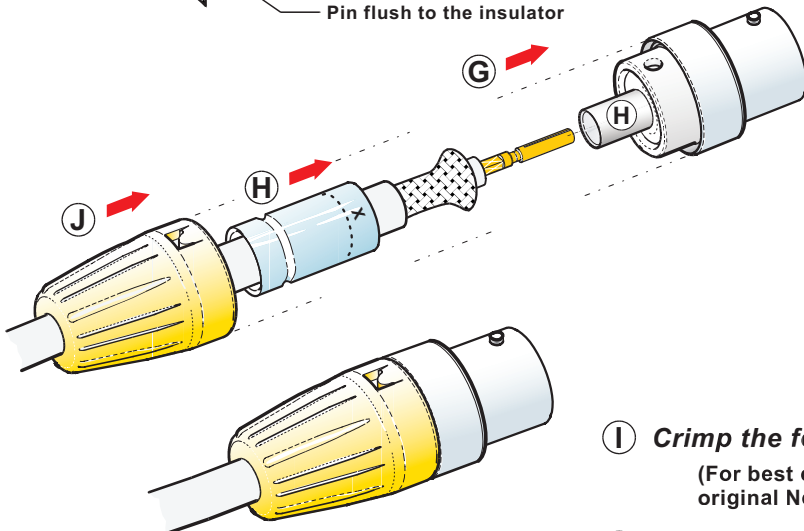

- (I) Crimp the ferrule with the tool
(For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)
- (J) Snap the boot onto the connector body

NEUTRIK AG
Liechtenstein
Tel.: +423/237 24 24
Fax: +423/232 53 93
www.neutrik.com

NEUTRIK Zürich AG
Switzerland
Tel.: +41 1/736 5010
Fax: +41 1/736 5011

NEUTRIK (UK) Ltd.
Great Britain
Tel.: +44 1983/811 441
Fax: +44 1983/811 439

NEUTRIK USA INC.
USA
Tel.: +1 732/901 9488
Fax: +1 732/901 9608

NEUTRIK Tokyo Ltd.
Japan
Tel.: +81 3/3663 4733
Fax: +81 3/3663 4796

NEUTRIK France
France
Tel.: +33 1/4131 6750
Fax: +33 1/4131 0511

NEUTRIK Vertriebs GmbH
Germany / Netherlands
Tel.: +49 8131/28 08 90
Fax: +49 8131/28 08-30

Draft Nr.: BDA 108 / 3102M1131
Update: 21.09.2004

Data subject to change without prior notice. ©2004 NEUTRIK®. ALL RIGHTS RESERVED.



NEUTRIK®
CONNECTING THE WORLD